



CAMSHAFT TIMING TAG


BC0334

Engine: TOYOTA 1JZGTE w/VVTi

	INT	EXH
Advertised Duration:	264°	264°
Duration @ .050":	218°	218°
Valve Lift (inches):	.344"	.344"
Valve Lift (mm):	8.74	8.74
Valve Lash (inches):	.006"	.008"

Recommended Valve Spring/Titanium Retainer Kit: BC0300

WARNING: Due to various cam gear thicknesses, make sure cam bolt does not bottom out in the cam threads. Clearance cam bolt length if necessary. Failure to check may cause engine damage.

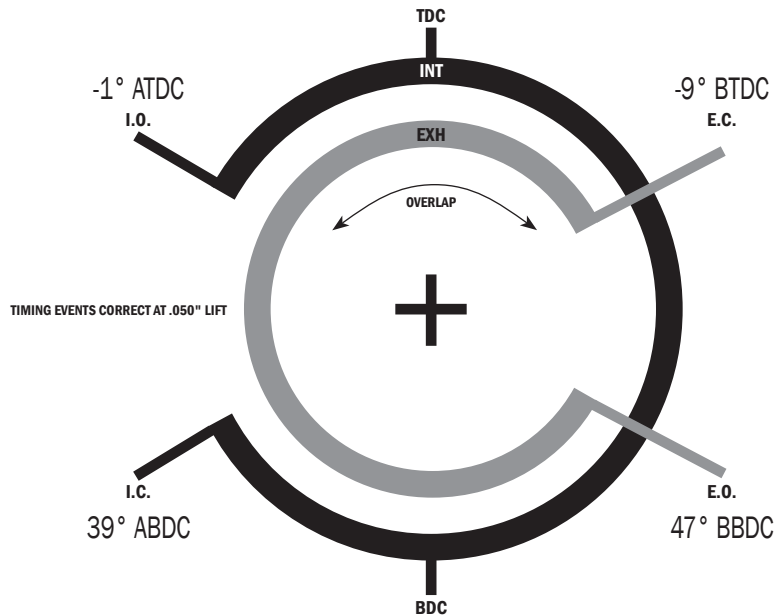

Camshafts damaged by improper installation, excessive spring pressure, valve train bind or retainers contacting valve guides or seals are void from warranty. Not legal for sale or use on emission controlled motor vehicles.



CAMSHAFT TIMING TAG


BC0334

Engine: TOYOTA 1JZGTE w/VVTi

	INT	EXH
Advertised Duration:	264°	264°
Duration @ .050":	218°	218°
Valve Lift (inches):	.344"	.344"
Valve Lift (mm):	8.74	8.74
Valve Lash (inches):	.006"	.008"

Recommended Valve Spring/Titanium Retainer Kit: BC0300

WARNING: Due to various cam gear thicknesses, make sure cam bolt does not bottom out in the cam threads. Clearance cam bolt length if necessary. Failure to check may cause engine damage.

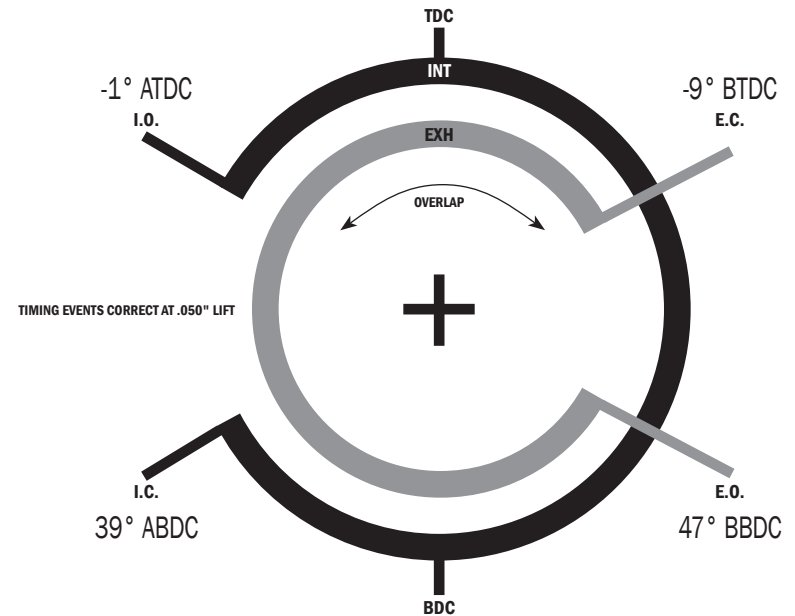

Camshafts damaged by improper installation, excessive spring pressure, valve train bind or retainers contacting valve guides or seals are void from warranty. Not legal for sale or use on emission controlled motor vehicles.